## MODIFICATION INSTRUCTION

Number: 210-2123

Year: 1999

Month: JUNE

Market: NOT PA

# Battery cover chafes against engine cover

0

# Customer satisfaction campaign 104 95

Cars in stock must be remedied before delivery.

A personal communication must be sent to the owners of cars already delivered requesting them to get in touch with the nearest Saab garage as soon as possible to have the fault rectified.

#### Cars affected

Saab 9-5 V6 M99 up to and including VIN X3033136

#### **Background**

On certain cars, the battery may be mounted too close to the engine cover. This can affect the throttle body and cause scuff marks on casings and covers.

## Parts required

71 56 409 Clips x2

## **Procedure**

Check box A5 on the modification identity plate before proceeding. Continue as follows if the box is not marked:

1 Remove the protective cover on the battery. Disconnect the positive and negative battery cables.

- 2 Detach the battery vent hose and undo the battery clamp.
- 3 Lift out the battery.
- 4 Loosen the battery tray and move as far to one side of the engine as possible. Tighten it in its new position.

0

Reference : X63669 11/18/01 Page 1 of 2

- 5 Fit 2 clips to the edge of the battery tray closest to the engine. Use a plastic mallet.
- 0
- 6 Place the gearbox vent hose under the cable duct supports.
- 7 Fit the battery. Allow the clips to act as spacers against the engine. Fit the battery clamp. Make sure the edge protection remains on the battery tray.
- 8 Connect the positive and negative battery cables.
- 9 Attach the battery vent hose.
- 10 Make sure the play between the engine cover and the edge of the battery flange is at least 16 mm. Fit the protective cover on the battery.

ш

- 11 ACC: Calibrate the heating and ventilation unit by starting the car while simultaneously pressing AUTO and OFF. Wait for 2 minutes until the heating and ventilation unit display shows the temperature instead of 0. Turn off the engine.
- 12 Set the clock and SID.

## Marking the modification identity plate

On completion of the necessary rectification, box A5 on the modification identity plate must be marked. If the work was carried out by the importer, mark the box with a "7". If done by a dealer, mark it with an "8".

# Warranty/Time Information

See separate information

Reference : X63669 11/18/01 Page 2 of 2