


**SERVICE INFORMATION**

Bulletin Nbr: 811-2236

Date:.....Maj 2000

Market: all

**Soft top cannot be operated**

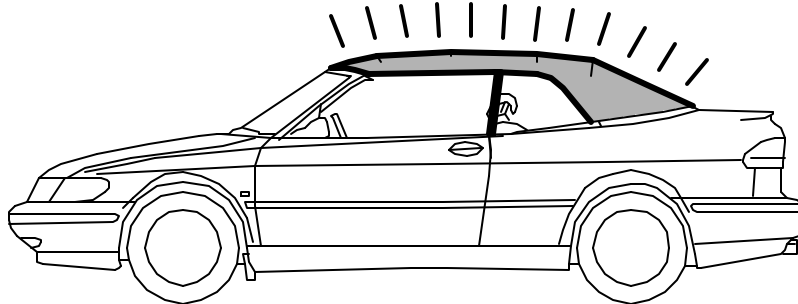

D811B183

**Cars affected**

Saab 9-3 CV M98 - M00 up to and including VIN Y7000913.

**Background**

The microswitches for the soft top cover latches can cause functional disorders and therefore have been replaced in production with microswitches of higher quality.

After customer complaint, proceed as follows.


**Symptom description**

The soft top cannot be operated or it stops in mid-operation. SID displays the message CHECK SOFT TOP COVER and the following diagnostic trouble codes may be generated: B2025, B2026, B2030, B2031.


**Parts required**



51 84 403 Microswitch

Procedure

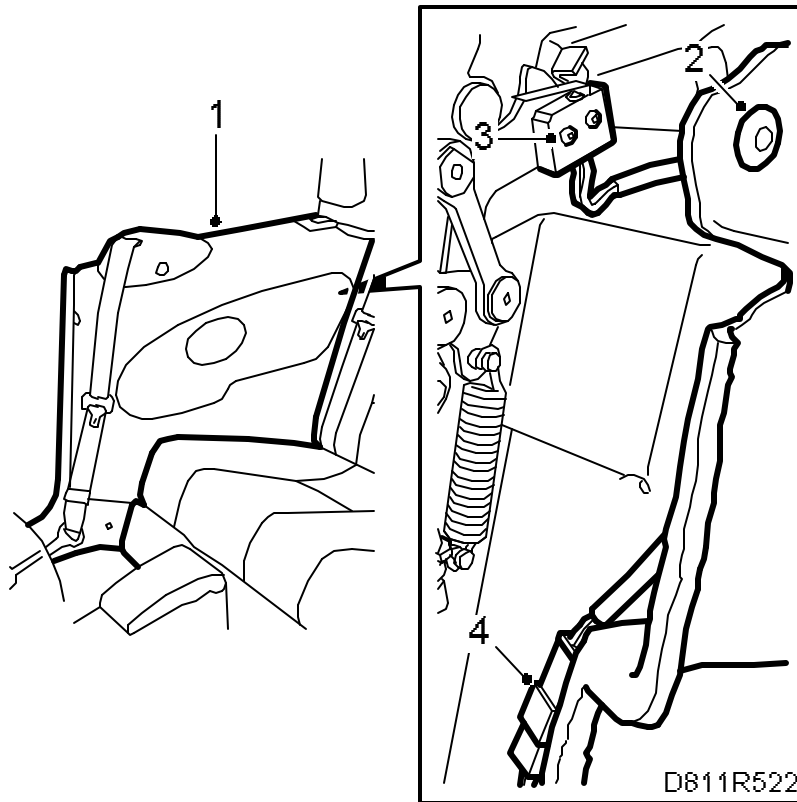


1. Remove the rear side trim. See "Body - Convertible - Adjustment/replacement - Rear side trim".
2. Remove the clip for the rear trim and lift up the trim.
3. Remove the screws holding the microswitch.
4. Unplug the connector and remove the microswitch.
5. Run the cable through the bracket for the backrest catch mechanism and fit the microswitch.

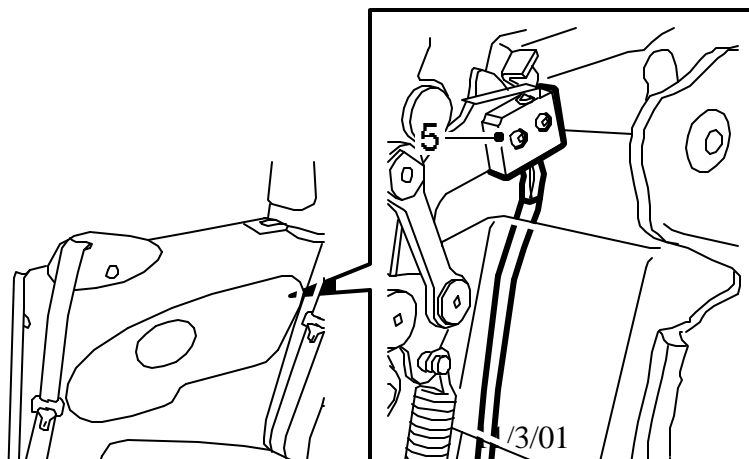

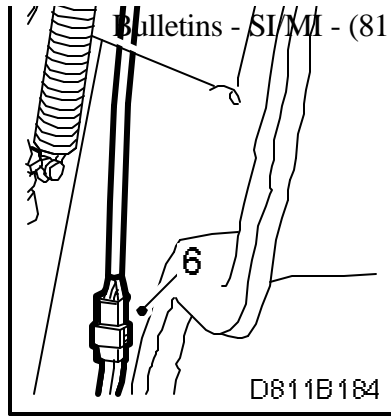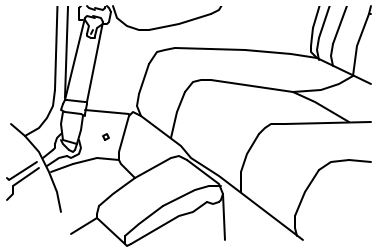

6. Plug in the connector.
7. Affix the tape.

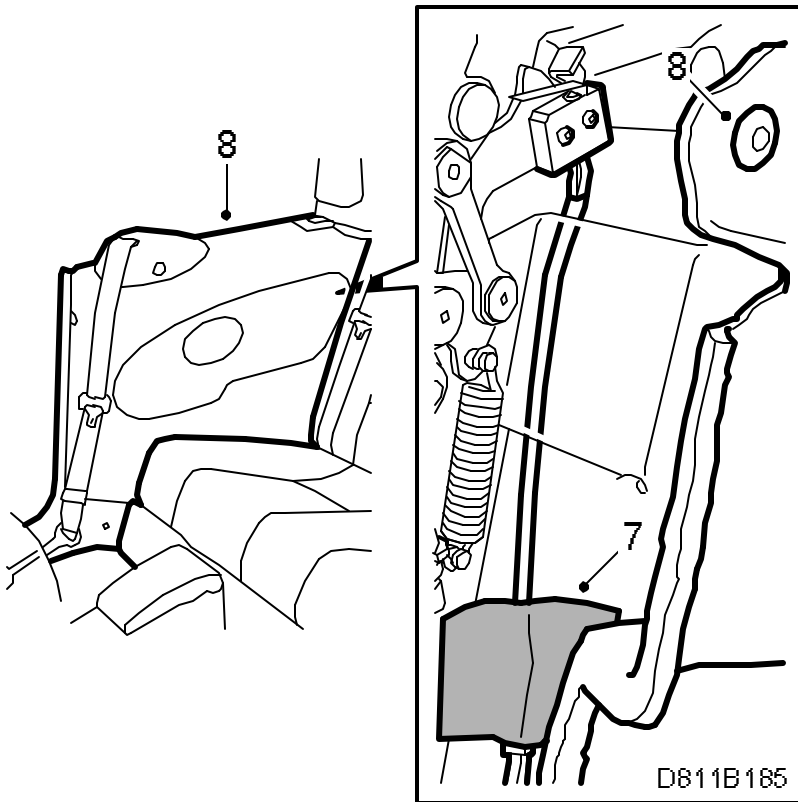

8. Fit the rear trim and the rear side trim. See "Body - Convertible - Adjustment/replacement - Rear side trim".
9. Connect the diagnostic tool and erase any diagnostic trouble codes.

**Time/Warranty information**

To resolve a customer complaint for a vehicle in warranty, submit a claim using the following

information:

Failed object: 36464

Fault/Reason code: 72

Location code: 09 (US=9)

Warranty type (US): 01

Repair/Action code: 01

Labor operation (US): 36464 (CA: 3291)

Time: 0.4 hrs.