

**TECHNICAL NEWS**

Bulletin Nbr: 99-02-367

Date:.....February 1999

Market: all

**No sound from CD changer**

**Cars affected**

Saab 9-3 CV, chassis no. X7020086-X7051607

**Background**

In cars not prewired for a CD changer, or with a factory-fitted CD changer, a wiring harness between H33-3 and 355ha may be missing (on left-hand A pillar).

**Parts required**

4 cables, brown, green, blue and red - length 250 mm

41 13 858 Connector (1)

41 15 192 cable terminal (4)

41 15 457 Cable terminal (4)

**Diagnostic procedure**

1. Connect the cables to the connector (41 13 858) as follows:
  - Brown (BN) cable to pin 1  
(cable terminal 41 15 192)
  - Green (GN) cable to pin 5  
(cable terminal 41 15 192)
  - Blue (BU) cable to pin 6  
(cable terminal 41 15 192)
  - Red (RD) cable to pin 2  
(cable terminal 41 15 192)
2. Connect the connector to 355ha on the A pillar's main wiring harness. The connector is fastened to the wiring harness with tape.
3. Connect the 4 new cables to connector H33-3 (blue) as follows:
  - Brown (BN) cable to pin 15  
(cable terminal 41 15 457)

- Green (GN) cable to pin 14  
(cable terminal 41 15 457)
- Blue (BU) cable to pin 31  
(cable terminal 41 15 457)
- Red (RD) cable to pin 32  
(cable terminal 41 15 457)