

TECHNICAL NEWS

Number: 99-02-831

Year: 1999

Month: FEBRUARY

Market: ALL

Wind noise from front side windows

Cars affected

All Saab 9-5

Background

When doors are mounted during manufacturing, some windows can end up 1 mm too high up.

This means that the door windows press out the weatherstrips when in their closed position. This results in wind and road noise.

Diagnostic procedure

▫

Remove the trim from the front door and adjust the set screws 1-2 mm upwards, see illustration. Refit the trim and testdrive the car to check that the window lift is correctly adjusted.