

**TECHNICAL NEWS**

Bulletin Nbr: 99-02-234

Date:.....February 1999

Market: all

**Causes, DTC P1220****Cars affected**

Saab 9-3 diesel.

**Background**

Faulty fuel supply, faulty fuel pump.

Current WIS information suggests replacing the diesel pump after DTC P1220. This can be correct if the pump has seized.

DTC P1220 can also be generated if the power supply is disturbed, which can be due to a clogged fuel filter or suction line, or a pinched or damaged fuel line,

Another cause of DTC P1220 is if the fuel return line is pinched.

**Procedure**

Check the lines for damage or leaks.

Information on measuring pressure and suggestions for suitable instruments will be included in a later version of WIS.