

### SERVICE INSTRUCTION


**Number:** 340-2030

**Year:** 1998

**Month:** OKTOBER

**Market:** ALL

### Starter motor must crank for a long time before engine starts

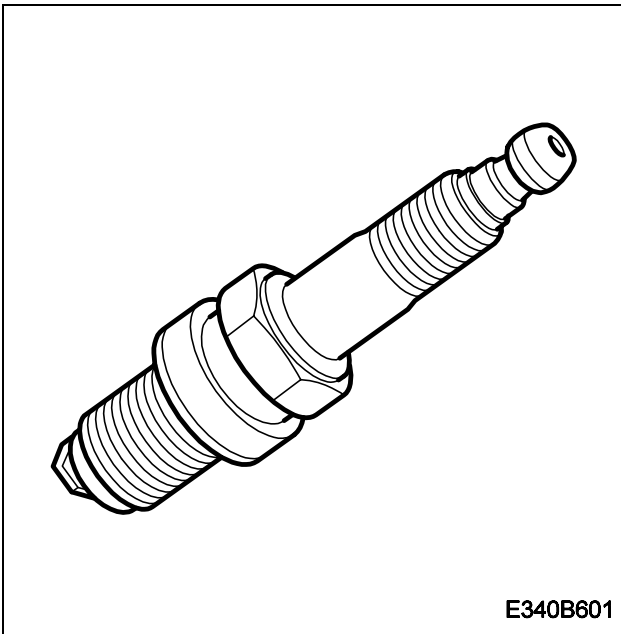

#### Cars affected

Saab 9-5 with B205E (150 hp) or B235E (170 hp) engine.

#### Background

On certain cars, the starter motor must be engaged for a long time before the engine starts, and some cars can be felt to be uncomfortable during starting. After customer complaint the procedure in this Service Information can be carried out.

#### Parts required

91 17 565 Spark plug BCPR6ES

(US: 02 44 772 Spark plug kit (type BCPR6ES)

CA: 30520467 Spark plug BCPR6ES)

#### Diagnostic procedure

When changing the spark plugs during a service, type BCPR6ES must be used. This will shorten the starting time and improve comfort while starting.