

**SERVICE INFORMATION**


**Number:** 254-1499

**Year:** 1994

**Month:** JUNI

**Market:** ALL

**Noise from secondary air injection pump**

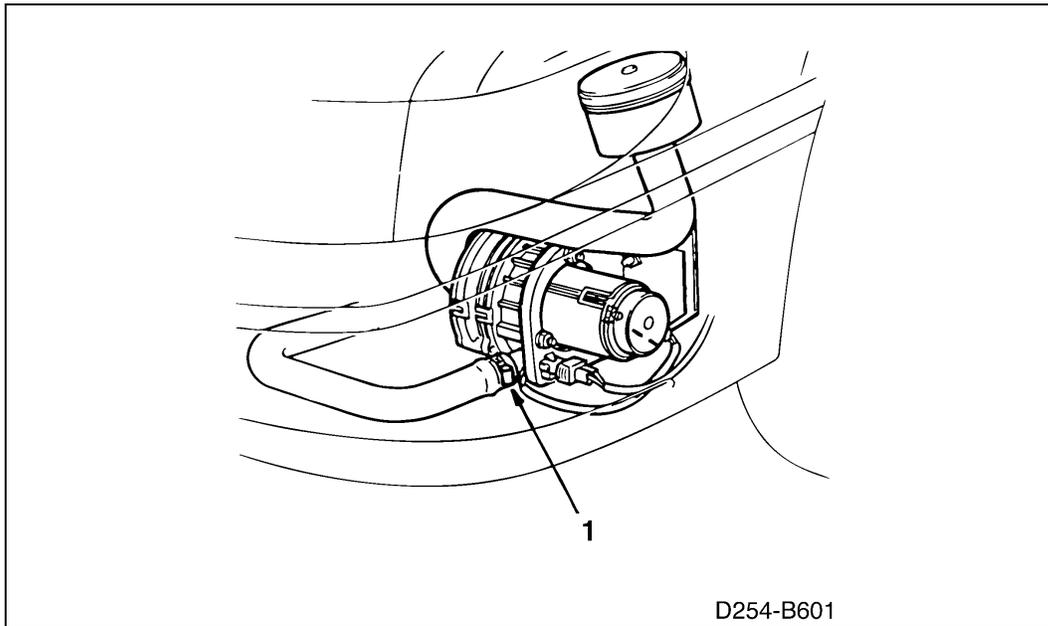

**Cars concerned**

Saab 900 M1994 with secondary air injection

**Background**

In certain cars with secondary air injection, the sound of the air pump can be disturbing. This can be due to the hose clamp (1) resting against the air shield. In the case of customer complaint, the following action can be taken.

**Procedure**

- 1 Undo and turn the hose clamp on the out hose from the air pump so that it is 2-3 mm from nearby parts.
- 2 Tighten the hose clamp. Start the engine and check that the noise has lessened/disappeared.

**Standard time information**

Object code: 25410 Fault code: 40 Localization code: 00 Action code: 05 Time: 0.2

**Warranty information**

Regular warranty rules apply.