

SERVICE INSTRUCTION


Number: 771-1886

Year: 1998

Month: MARCH

Market: ALL

New wheel bolt

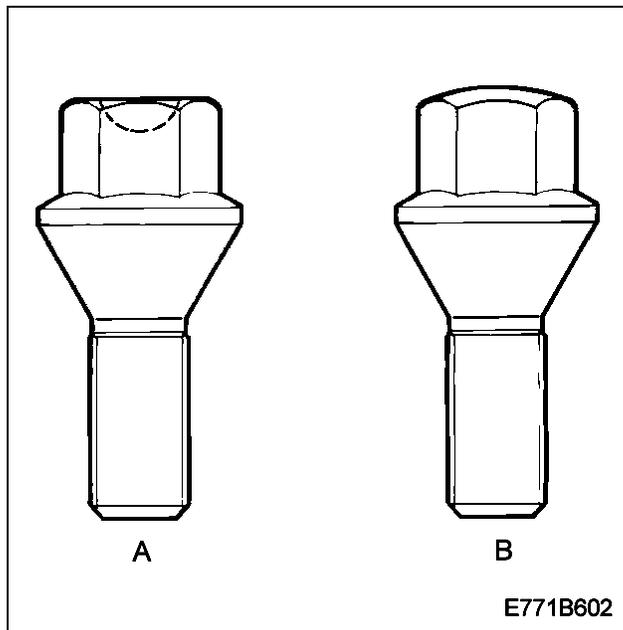

Cars affected

Saab 9-5 from M98.

Background

A new wheel bolt (**B**) with another surface coating has been introduced in production. This bolt has a higher friction than the bolt used earlier (**A**), which results in an increasingly stable tightening torque.

The tightening torque for the new bolt (**B**) is the same for both steel wheels and light alloy wheels.

Tightening torque 120 Nm (88.8 lbf ft)

Parts required

49 08 067 New wheel bolt (CA: 30570431)

(Saab STD 2883-81, Dacromet without teflon and without wax Gleitmo 602)