


TECHNICAL NEWS

Bulletin Nbr: 98-11-475

Date:.....NOVEMBER 1998

Market: ALL

Noise from outboard drive shaft CV joints

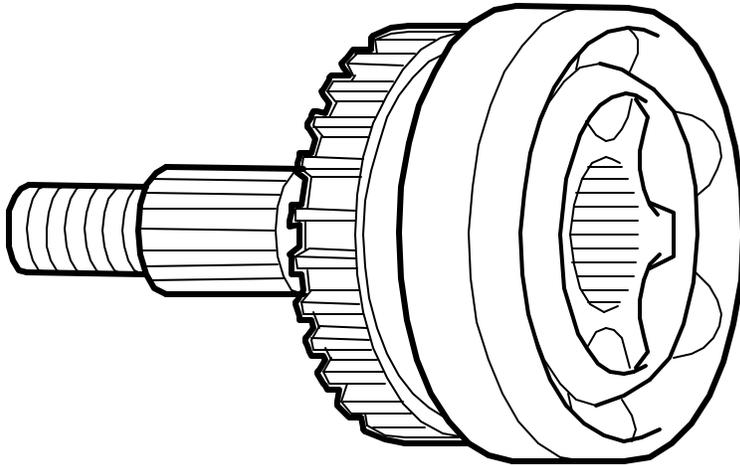

D475B602

This Technical News supersedes

SI 475-1891, SI 475-1892 and SI 475-1883

Cars affected

All cars.

Background

On new cars, noise from the outboard driveshaft CV joints can be heard when the wheels are turned to full lock at the same time as the accelerator is depressed.

This is because the grease in the joints has not had time to be properly distributed.

Procedure

In the case of a complaint about the above, inform the customer that the noise will disappear when the car has been driven normally for about 100-150 km (65-100 miles).