

SERVICE INFORMATION


Number: 551-1579

Year: 1995

Month: FEBRUARI

Market: ALL

Binding handbrake lever

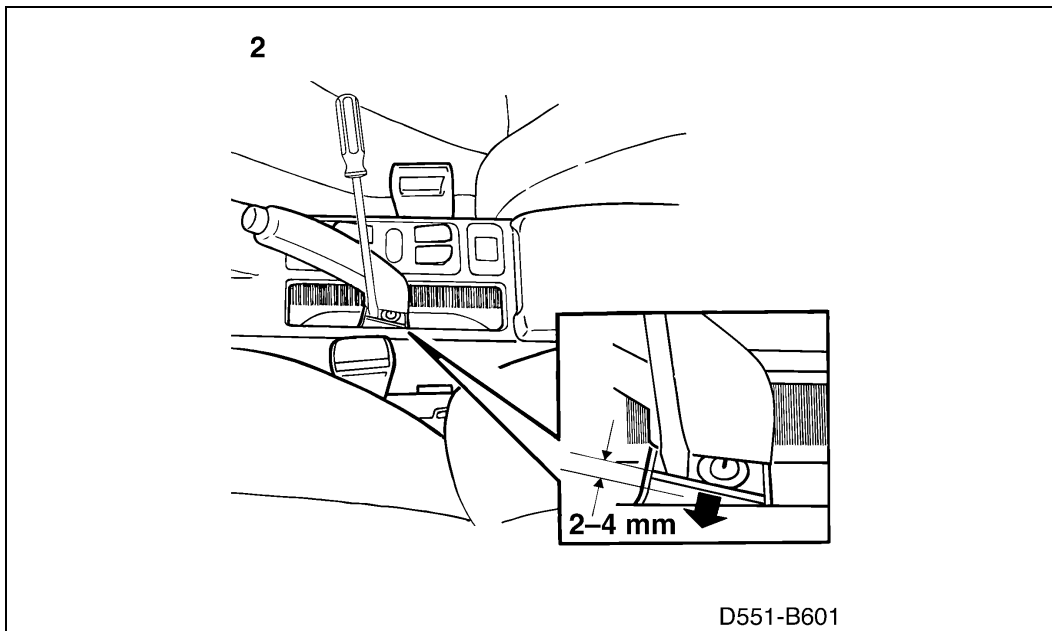

Cars concerned

Saab 900 M94-

Background

On some cars the handbrake release button may stick in the depressed position on releasing a handbrake lever that has been pulled on very hard. In the event of complaints from customers, the following procedure may be adopted.

Procedure

- 1 Remove the left-hand brush in the cover by snapping it off its mounting.
- 2 Prise out the metal plate 2-4 mm so that it clears the cable/rod at its upper edge.
- 3 Refit the brush.

Standard time information

Object code: 55122

Fault code: 26

Localization code: 00

Action code: 05 Time: 0.1

Warranty information

Regular warranty rules apply.