

SERVICE INFORMATION


Number: 644-1567

Year: 1995

Month: OKTOBER

Market: ALL

Topping up with power steering fluid

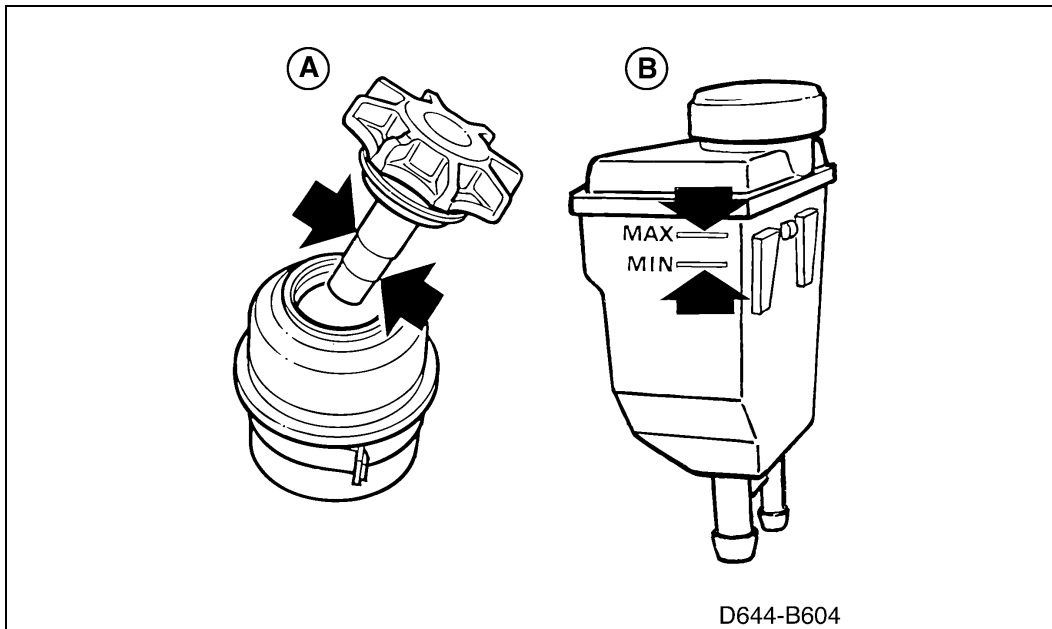

Cars concerned

All 1994 and later Saab 900 models.

Background

Power steering fluid has leaked out of the fluid reservoir in certain cases. This has happened in conditions of high temperature and at full lock. To avoid such leakage, the directions in this SI should be followed when topping up with power steering fluid.

Procedure

- 1 Make sure that temperature of the fluid in the power steering system is about +20°C.
- 2 Turn the front wheels to the straight ahead position.
- 3 Check the fluid level. In this position it should be midway between the MAX and MIN marks on the dipstick fitted to the screw cap of the power steering fluid reservoir (A). On cars equipped with the Sensonic system, the marks are on the power steering fluid reservoir itself (B).